

## Toner Sweep Rebuild Kit

**NATT #:** 02036058

### For use in:


AF 1035/ AF 1045/ AF 2035/ AF 2035e/ AF 2045/ AF 2045e/ AF 3035/ AF 3045/ AF MP3500  
AF MP4000/ AF MP4001/ AF MP4500/ AF MP5000/ AF MP5001/ AF SP8200DN/ 2235/ 2245/ 2535  
2545/ 4035/ 4045/ 8035/ 8045/ 9040/ 9050/ 9240/ 9250/ MLP150DN/ 3502/ 3532/ 4502/ 4532  
DSm635/ DSm645/ DSm735/ DSm745/ 5635/ 5645/ LD035/ LD040/ LD045/ LD050/ LD135/ LD140  
LD145/ LD150/ LD235/ LD245/ LD335/ LD345/ LPN150DN

### Kit Contains:

**4 - A2323243 Toner Sweeps**

**1 - Alcohol Wipe**

**Install Instructions**

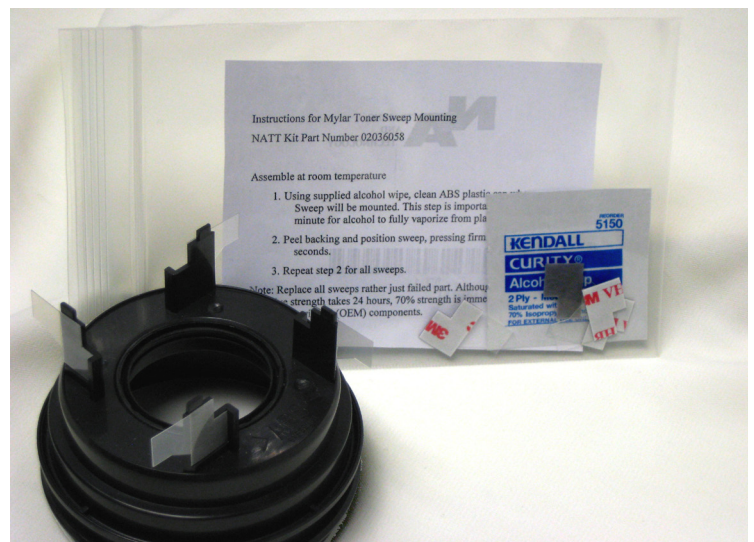

### Background Information and Discussion of Problem:

The Mylar (OEM #: A2323243) toner sweeps peel off the hopper cap (OEM #: A2323240) and foul the toner supply system.

### Causes:

Failure of adhesive holding toner sweep to cap.

### Solution:

Use a very high bond (VHB) adhesive on the toner Mylar. VHB is a stronger adhesive, which when applied to a clean surface, eliminates the Mylar peeling off the cap. This results in fewer unscheduled service calls, an extended toner hopper life as well as an increase in customer satisfaction and improved service profits.

To learn more about **NA Trading** and our complete line of **Repair Items**, contact a product specialist or visit us online today.

**800 231 8434**

**www.natrading.com**